Installation Instructions schneider-electric.com | 1

# **SpaceLogic** Sensors Resistive Temperature Sensors – Analog





## **Product Description**

SLA Series Living Space Resistive Temperature Sensors offer a reliable 10K Type 3 thermistor and the same look and feel as communicating SXWS sensors. The SLA Series sensors provide a low cost option for measuring temperature in a living space application.

## **Features**

- Medium matte white housing or optimum glass panel housing available in white or black
- Low cost conformance part
- 10K Type 3 thermistor
- · Two-wire resistive device

## **Available Products**

Model Number	Description	Housing Type	Sensor Type
SLASXXX	Sensor, Temperature, 10KT3, Matte White	Matte White	10K Type 3 Thermistor
SLAWXXX	Sensor, Temperature, 10KT3, Optimum White	Optimum White	10K Type 3 Thermistor
SLABXXX	Sensor, Temperature, 10KT3, Optimum Black	Optimum Black	10K Type 3 Thermistor

USA: +1 888-444-1311 Europe: +46 10 478 2000 Asia: +65 6484 7877



## **Specifications**

Temperature Sensor					
Туре	10K Type 3 thermistor				
Accuracy	±0.2 °C (±0.36 °F) typical				
Operating Environment					
Operating temperature	0 to 50 °C (32 to 122 °F)				
Operating humidity range	0 to 95% RH, non-condensing				
Housing material	High impact ABS plastic Flammability rating UL 94 V-0				
Mounting location	Not suitable for wet locations. For indoor use only.				
Wiring					
Two screw terminals	18-22 AWG, two-wire thermistor				
Regulatory Information					
Agency approvals	UL 916, European conformance CE: EN61000-6-3 EN61000 Series - industrial immunity standard FCC Part 15 Class B, REACH, RoHS, Green Premium, RCM (Australia), ICES-00 (Canada), EAC (Russia)				

## **Thermistor Table**


°F	Resistance ( $\Omega$ )		
32	29,575		
41	23,504		
50	18,809		
59	15,146		
68	12,271		
77	10,000		
86	8,195		
95	6,752		
104	5,592		
113	4,655		
122	3,893		
	32 41 50 59 68 77 86 95 104		

#### **Precautions**

- This product is not intended for life or safety applications.
- Do not install this product in hazardous or classified locations.
- Read and understand the instructions before installing the product.
- Turn off all power supplying equipment before working on
- The installer is responsible for conformance to all applicable codes.


If this product is used in a manner not specified by the manufacturer, the protection provided by the product may be impaired. No responsibility is assumed by the manufacturer for any consequences arising out of the use of this material.

# Dimensions mm (in.) **Optimum Housing**

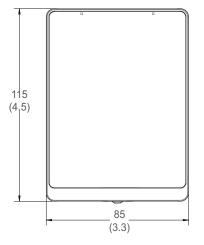



## Medium Housing

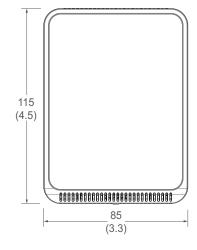



USA: +1 888-444-1311 Asia: +65 6484 7877



## **Functions**

The SLA Series sensor measures temperature in living space applications. It provides a resistive output to an I/O port on MP, RP, Continuum or other controllers able to use a 10K Type 3 thermistor.

## Installation

1. Position the sensor vertically on the wall 1.35 m (4.5 ft.) above the floor with the "UP" arrow facing upward. Locate away from windows, vents and other sources of draft. If possible, do not mount on an external wall, as this may cause inaccurate temperature readings.





Pull 18 or 22 AWG two-conductor cable(s) through the hole in the backplate.



Mount the backplate onto the wall using the screws provided.



4. Connect the wires to the termistor terminals. Do not over-tighten the screws.



5. With sensor base fully installed, align top of cover to mounting tabs on top of sensor base. Swing cover downward until it latches at the bottom.



Install locking screw to secure cover in closed position.



USA: +1 888-444-1311 Asia: +65 6484 7877



# China RoHS Compliance Information Environment-Friendly Use Period (EFUP) Table

部件名称	有害物质 - Hazardous Substances						
Part Name	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr (VI))	多溴联苯 (PBB)	多溴二苯醚 (PBDE)	
电子件 Electronic	Х	0	0	0	0	0	

# 本表格依据SJ/T11364的规定编制。

- O:表示该有害物质在该部件所有均质材料中的含量均在GB/T 26572规定的限量要求以下。
- X: 表示该有害物质至少在该部件的某一均质材料中的含量超出GB/T 26572规定的限量要求。

( $\mathbf{\hat{c}}$ 业可在此处,根据实际情况对上表中打  $^{\times}$ :的技术原因进行进一步说明。)

This table is made according to SJ/T 11364.

O: indicates that the concentration of hazardous substance in all of the homogeneous materials for this part is below the limit as stipulated in GB/T 26572.

X: indicates that concentration of hazardous substance in at least one of the homogeneous materials used for this part is above the limit as stipulated in GB/T 26572

Z000057-0B

USA: +1 888-444-1311 Europe: +46 10 478 2000 Asia: +65 6484 7877

